

PART NUMBER	CI	NUMBER OF	DIMENSION OF CONNECTOR, FPC PATTERN AND METAL MASK							DIMENSION OF DRAWING FOR PACKING				
PANT NUMBER	CL	CONTACT	А	В	С		Е	F	G	Н		K		
FH26W-13S-0.3SHW(60)	CL580-2401-1-60	13	5. 4	3.0	3.6	4.23	4.9	4.2	16	_	7.5	17.4	21.4	
FH26W-15S-0.3SHW(60)	CL580-2402-4-60	15	6.0	3.6	4.2	4.83	5.5	4.8	16	1	7.5	17.4	21.4	
FH26W-17S-0.3SHW(60)	CL580-2403-7-60	17	6.6	4.2	4.8	5.43	6.1	5.4	16	1	7.5	17.4	21.4	
FH26W-19S-0.3SHW(60)	CL580-2437-9-60	19	7.2	4.8	5. 4	6.03	6.7	6.0	16	_	7.5	17.4	21.4	
FH26W-21S-0.3SHW(60)	CL580-2404-0-60	21	7.8	5.4	6.0	6.63	7.3	6.6	16	_	7.5	17.4	21.4	
FH26W-23S-0.3SHW(60)	CL580-2405-2-60	23	8.4	6.0	6.6	7.23	7.9	7.2	16	_	7.5	17.4	21.4	
FH26W-25S-0.3SHW(60)	CL580-2406-5-60	25	9.0	6.6	7.2	7.83	8.5	7.8	16	_	7.5	17.4	21.4	
FH26W-27S-0.3SHW(60)	CL580-2400-9-60	27	9.6	7.2	7.8	8. 43	9.1	8.4	16	_	7.5	17.4	21.4	
FH26W-29S-0.3SHW(60)	CL580-2407-8-60	29,	10.2	7.8	8.4	9.03	9.7	9.0	24	_	11.5	25.4	29.4	
FH26W-31S-0.3SHW(60)	CL580-2408-0-60	31	10.8	8.4	9.0	9.63	10.3	9.6	24	_	11.5	25.4	29.4	
FH26W-33S-0.3SHW(60)	CL580-2409-3-60	33	11.4	9.0	9.6	10.23	10.9	10.2	24	_	11.5	25.4	29.4	
FH26W-35S-0.3SHW(60)	CL580-2410-2-60	35	12.0	9.6	10.2	10.83	11.5	10.8	24	_	11.5	25.4	29.4	
FH26W-37S-0.3SHW(60)	CL580-2411-5-60	37	12.6	10.2	10.8	11.43	12.1	11.4	24	_	11.5	25.4	29.4	
FH26W-39S-0.3SHW(60)	CL580-2412-8-60	39	13.2	10.8	11.4	12.03	12.7	12.0	24	_	11.5	25.4	29.4	
FH26W-41S-0.3SHW(60)	CL580-2413-0-60	41	13.8	11.4	12.0	12.63	13.3	12.6	24	_	11.5	25.4	29.4	
FH26W-45S-0.3SHW(60)	CL580-2414-3-60	45	15.0	12.6	13.2	13.83	14.5	13. B	24	_	11.5	25.4	29.4	
FH26W-51S-0.3SHW(60)	CL580-2415-6-60	51	16.8	14.4	15.0	15, 63	16.3	15.6	24	_	11.5	25.4	29.4	
FH26W-55S-0.3SHW(60)	CL580-2416-9-60	55	18.0	15.6	16.2	16.83	17.5	16.8	32	28.4	14.2	33.4	37.4	
FH26W-57S-0.3SHW(60)	CL580-2417-1-60	57	18.6	16.2	16.8	17. 43	18.1	17.4	32	28. 4	14.2	33.4	37.4	
FH26W-61S-0.3SHW(60)	CL580-2418-4-60	61	19.8	17.4	18.0	18.63	19/3	18.6	32	28.4	14.2	33.4	37.4	
FH26W-71S-0.3SHW(60)	CL580-2419-7-60	71	22.8	20.4	21.0	21.63	22.3	21.6	44	40.4	20.2	45. 4	49. 4	

PART FH26W-**S-0.3SHW(60)

CODE NO. CL580 4

FORM HC0011-5-8 1 2 3 4 5

This connector is small and thin and requires delicate and careful handling. Read through the instructions shown below and handle the connector properly. Each values indicating here are for reference and may differ from standard value.

[INSTRUCTIONS FOR MOUNTING ON THE BOARD]

♦Warp of Board

Minimize warp of the board as much as possible.

Lead co-planarity including reinforced metal fittings is 0.1 mm or less. Too much warp of the board may result in a soldering failure.

♦Flexible board design Please make sure to put a stiffener on the backside of the flexible board. We recommend a glass epoxy material with the thickness of 0.3mm MIN

♦Load to Connector

Do not add 0.5N or greater external force when unreel or pick and place the connector etc. or it may get broken.

In addition, do not insert the FPC or operate the connector before mounting i

[INSTRUCTIONS FOR PCB HANDLING AFTER MOUNTING THE CONNECTOR]

♦Load to Board

·Splitting a large board into several pieces

·Screwing the board


Avoid the handling described above so that no force is exerted on the board during the assembly process Otherwise, the connector may become defective.


♦Amount of Warp

FORM HC0011-5-8 1

The warp of a 100-mm wide board should be 0.5 mm or less.

The warp of board suffers stress on connector and the connector may become defective.

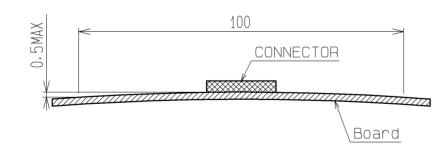

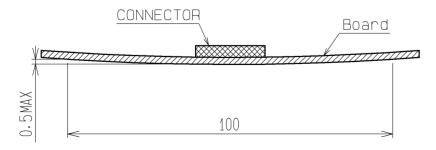


INSTRUCTIONS ON INSERTING FPC AND CONNECTION!

♦ Use of the actuator

1. Be very careful not to apply excessive force when releasing the actuator in the initial position (with no FPC inserted).


If you use your nail or finger as shown below, the terminals may be deformed.

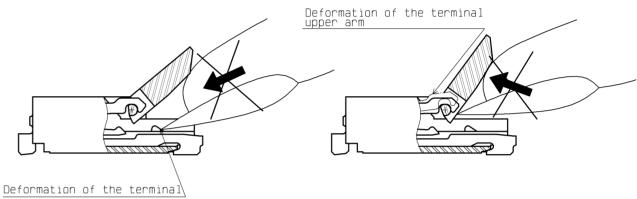


Example 1.

Example2.

2. The actuator rotates around the rotational axis as shown below Rotate the actuator.

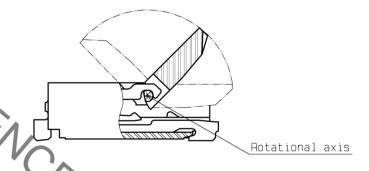


3. The actuator will not open more than 135°. Do not apply any force backward beyond this point. Otherwise, the actuator may come off or break.

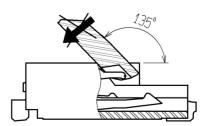

	HS.	DRAWING NO.	ΕC	003-3237	14-05				
▎╊		PART NO.	FH26W-**S-0.3SHW(60)						
		CODE NO.	С	L580		\triangle	5/6		
		7			8				

- 4. Move the actuator at approximately the center.
- 5. Do not pinch or pick the actuator to lift it as shown below. Otherwise, it may break. (Do not carry out any operation other than rotating the actuator as shown in 2 above.)

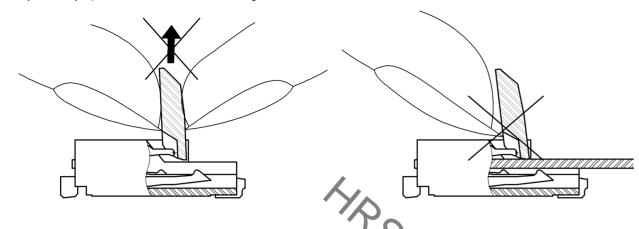

♦Direction of Contacts

This connector has contacts on the bottom. Thus, insert the FPC with the exposed conductors face down.

1. Insert the FPC horizontally along the surface and at a right angle to the connector. Insert it properly to the very end.

If the FPC is inserted at a slant (incorrectly),

the conductors may short-circuit due to pitch shift or the edge of the FPC may catch in the terminal resulting in deformation of the terminals.


This connector has a ZIF structure, and its effective engagement length is 0.35 mm (when the recommended FPC nominal is used).

Use the actuator carefully to prevent the FPC from dislocating after inserting it.

2. Do not insert the FPC diagonally from above. If the FPC is inserted at a slant (incorrectly) as shown below in the FPC insertion process. the FPC may bend and patterns may break or the FPC may not insert completely. resulting in improper conduction.

*Keep a sufficient FPC insertion space in the stage of the layout in order to avoid incorrect FPC insertion. Besides, it is not difficult to insert FPC correctly all the way to the end. Design the proper layout of parts.

XMake adjustments with the FPC manufacturer for FPC bending perfomance and wire breakage.

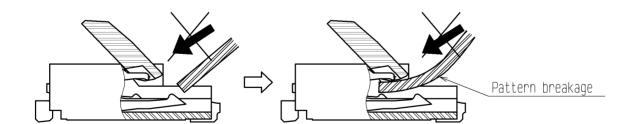


◆Checking the Locking Condition

In the locked condition, make sure that the actuator is horizontal on the board surface. Do not apply excessive force to it near the 0° position of the actuator. Otherwise, the terminals may be deformed. (Allowable force: 1 N or less)

[INSTRUCTIONS ON FPC LAYOUT AFTER CONNECTION]


♦Load to FPC

Be very careful not to apply any force to the FPC after inserting it. Otherwise, the connector may become unlocked or the FPC may break. Fix the FPC, in particular, when loads are applied to it continuously. Design the FPC layout with care not to bend it sharply near the insertion opening.



INSTRUCTIONS ON REMOVING FPC!

♦Release the actuator to remove the FPC.

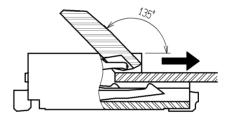

♦Instructions on Manual Soldering

Follow the instructions shown below when soldering the connector manually during repair work, etc.

1. Do not perform reflow soldering or manual soldering with the FPC inserted into the connector.

2. Do not heat the connector excessively. Be very careful not to let the soldering iron contact any parts other than connector leads. Otherwise, the connector may be deformed or melt.

3. Do not use excessive solder (or flux).

If excessive solder (or flux) is used on the terminals, solder or flux may adhere to the contacts or rotating parts of the actuator, resulting in poor contact or a rotation failure

Supplying excessive solder to the reinforcing bracket may hinder actuator rotation. resulting in breakage of the connector.

		DRAWING NO.	EDC3-323714-05		
	H35	PART NO.	FH26W-**S-0.3SHW(60>	
╽╹		CODE NO.	CL580	\triangle	6/6
		7	8		

FORM HC0011-5-8 1

Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

Hirose Electric: FH26W-21S-0.3SHW(60)